

Company Name

City, State

Priority

2

INVENTORY NO. 004

COMPANY TECHNICIAN: Mr. Randy Davis

ADDRESS: 1301 Oberlin Road SW
Massillon, OH

LOCATION: Main Substation

EQUIPMENT: North Cap. Bank Yard
Center Phase Buss-to-Underground Feeder
Connection.

FINDINGS: Suspect loose deteriorated Buss-to-
Underground Feeder Connection

RECOMMENDATIONS: Inspect, clean, and tighten
center phase buss connector and all related
components.

EXCEPTION TEMP. (Area.1): 71F

REFERENCE TEMP. (Area 2): 50F

DELTA-T: 21F


PRIORITY RATING: (NETA STANDARDS)

*Indicates probable deficiency; repair as time
permits.*

PRIORITY 2



Visual Control Photo

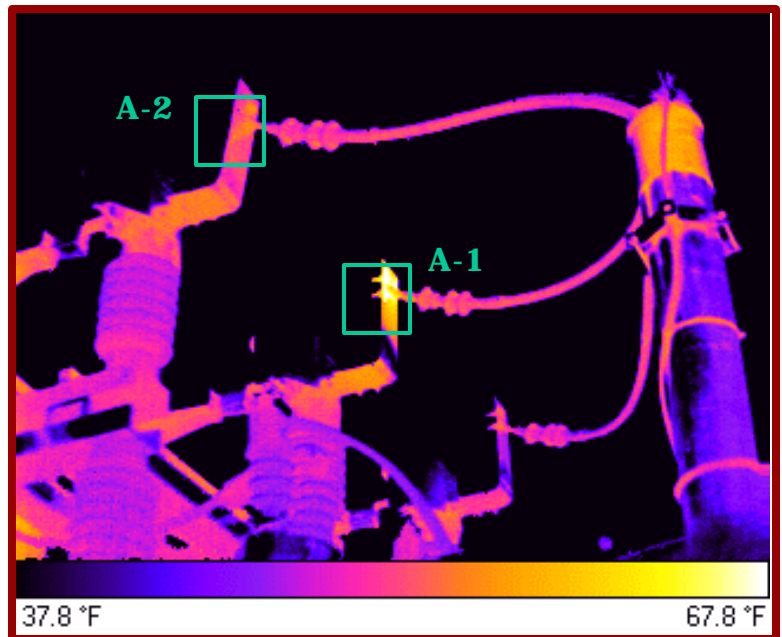

Thermal Infrared Exception Photo

Notes: Normal Thermograph of South Bank

